



1 Preparation

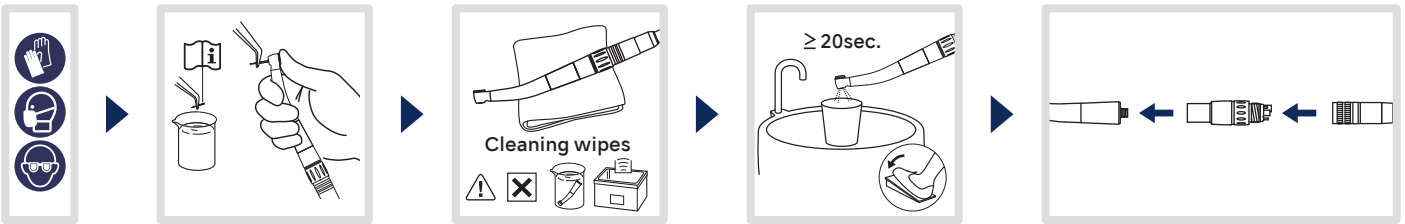

2 Cleaning and Drying

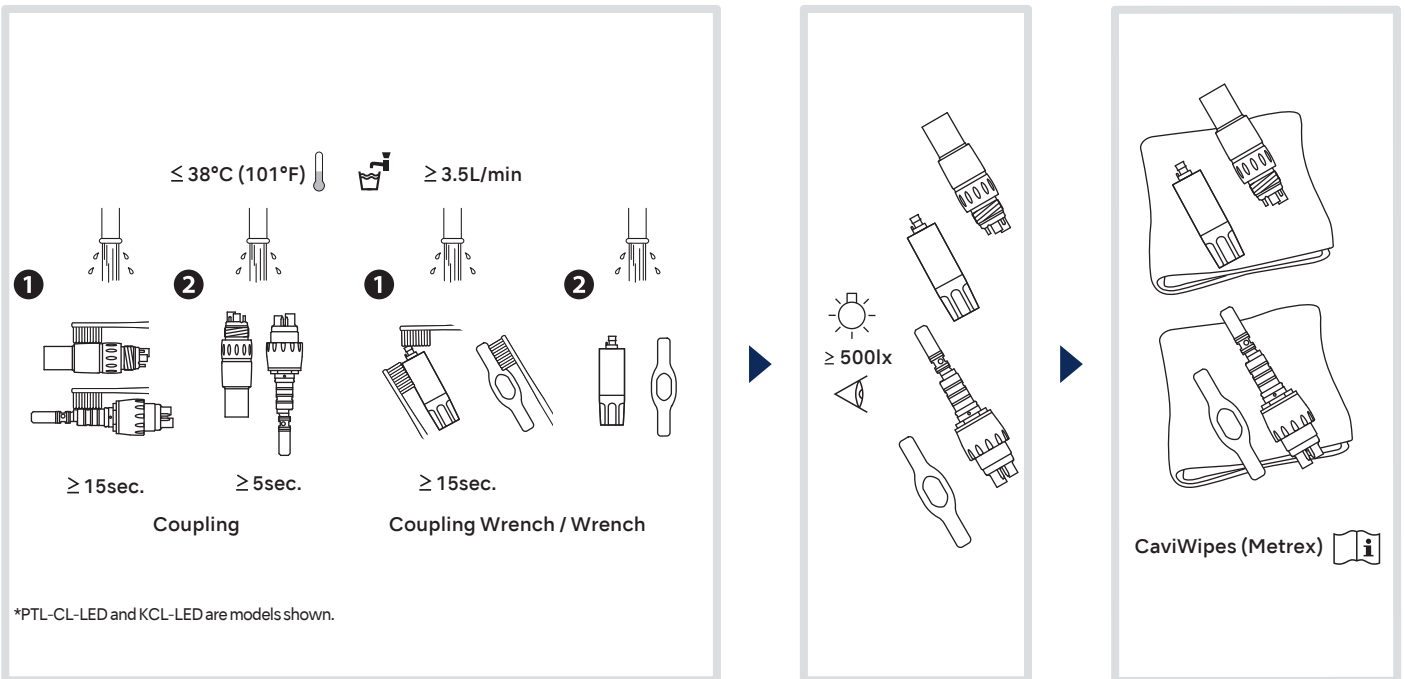

- After cleaning, if moisture is present, wipe off with a dry cloth or blow it off with compressed air until there is no moisture in the interior and exterior.
- When blowing off with compressed air, cover the product with cloth to prevent scattering of water.
- Use a state-sanctioned disinfectant with proven bactericidal, fungicidal, and virucidal properties.

3 Packaging, Sterilizing, and Drying

ISO 11607-1

Use an FDA-approved sterilization pouch that conforms to ISO 11607-1, and seal the pouch.
Maximum temperature for NSK instruments is 135°C (275°F).

Type	Gravity Displacement	Pre-Vacuum (Dynamic Air Removal)
Temperature	132°C (270°F)	132°C (270°F)
Full Cycle Time	15min	4min
Drying Time	30min	30min

Perform steam sterilization with the above conditions. Use an FDA-approved steam sterilizer to perform sterilization.

CAUTION

✓ Steam sterilization

✗ Plasma

✗ EO

- Do not attempt to sterilize the coupling wrench made of resin.

4 Storage

